


| Tree Inventory | | | | | | | | | | | | CODES | (, , , |
|-------------------|--|---|----------------|----------|----------|----------------|------|-------|-----|------|-------|--|--------------------------------------|
| Project: | 150 Cemetery Road | | | | | | | | | | DBH | | (mm) |
| | | | | | | | | | | | SPR | | (m) |
| | | | | | | | | | | | HT | Height | (m) |
| IKA Job#: | 2021-082 | | | | | | | | | | TI | Trunk Integrity | (G,F,P) |
| | | | | | | | | | | | CS | Crown Structure | (G,F,P) |
| Date: | Aug.25.2023 | | | | | | | | | | CV | Crown Vigor | (G,F,P) |
| Conditions: | | | | | | | | | | | CDB | Crown Die Black | (%) |
| | | | | | | | | | | | SPP | Species Potential | (L,M,H) |
| | | | | | | | | | | | SIP | Site Potential | (L,M,H) |
| | | | | | | | | | | | PHY | Physical Condition | (text) |
| nventory Done By: | KL | | | | | | | | | | ~ = E | stimate (L)=low (M)=moderate (H)=high (G) = G | ood, (|
| | | | | | | | | | | | | | |
| Tree Tag # | Common Name | Scientific Name | DBH | SP | НТ | TI | CS | CV | CDB | SPP | SIP | PHY Notes | Recommendation (REMOVE/RETAIN |
| 47 | Common spruce | Picea abies | 42 | 9 | 16 | F | F | F | 10% | #N/A | | | REMOVE FOR DEVELOPMENT |
| 48 | Black pine | Pinus nigra | 37 | 6 | 15 | F | F | F | 15% | #N/A | | Broken branches | REMOVE FOR DEVELOPMENT |
| 48B | Black pine | Pinus nigra | 26 | 4 | 12 | F | P | F-P | 20% | #N/A | | Broken branches | REMOVE FOR DEVELOPMENT |
| 48C | Black pine | Pinus nigra | 17 | 2 | 12 | F | Р | F-P | 20% | #N/A | | Vine along trunk | REMOVE FOR DEVELOPMENT |
| 49 | Common spruce | Picea abies | 47,48 | | 20 | F | F | F | 5% | #N/A | | 2 leaders. Some understory. Maintenance to lower branches | REMOVE FOR DEVELOPMENT |
| 50 | Manitoba maple | Acer negundo | 40,100 | 14 | 15 | F | F | F | 10% | L | | Rhamnus. Maintenance to branches. Broken branches. Spalding bark, Wide spreading canopies. Socking. Torsion. Hollow portion of trunk | REMOVE FOR DEVELOPMENT |
| 50B | Common spruce, Silver maple, Black pine, White pine, Norway maple, Buckthorn | Picea abies, Acer saccharinum, Pinus nigra, Pinus strobus, Acer platanoides, Rhamnus cathartica | 15-43 | 3 to 10 | 10 to 18 | F | F | F-P | 15% | #N/A | | 12+ trees in group. Thick rhamnus understory. Broken branches, Competing canopies. Naturally regenerating | REMOVE FOR DEVELOPMENT |
| 51 | Common spruce | Picea abies | 54 | 9 | 17 | F | G | F | 10% | #N/A | | Low growing spruce. Shrub adjacent. Snag adjacent | REMOVE FOR DEVELOPMENT |
| 518 | Trembling aspen, Malus sop, White | Populus tremuloides, Malus spp. Pinus strobus, Fagus | | 3 10 8 | 9 to 20 | | F | F | 15% | #N/A | | Stand of primary Trembling aspen. Naturally regenerating. 45+ trees. | PARTIALLY REMOVE |
| | Rhamnus, Norway rnaple | grandifolia, Rhamnus, Acer platanoides | | | | | | | | | | Standing snags through area | |
| 51C | Northern red oak | Quercus rubra | 48 | 12 | 20 | Ğ | F | F | 15% | #N/A | | Surrounded by snags/naturally regenerating species. Some spalding bark/Broken branches | REMOVE FOR DEVELOPMENT |
| 51D | Poplar | Populus spp. | 53 | 8 | 20 | F | F | F | 20% | L | | Lean to east. Rhamnus understory. Some broken branches. On slope | RETAIN & PROTECT |
| 52 | Common spruce, White pine | Picea abies, Pinus strobus | 20 to 30 | 5 to 7 | 11 to 15 | F | F | F | 20% | #N/A | | 4 trees | REMOVE FOR DEVELOPMENT |
| ////52B///// | //Cornrnon spruce// | ////Picea/abies//// | 18 to 38 | /3/16/1/ | 12/0/18 | //=// | 1/1/ | /F-P/ | 15% | #NVA | 1//// | 604 trees. Scarce interior canopies. | //PARTIALLY/REMOVE |
| | | | | | | | | | | | | Along P.L. Some buckthorn/Cedar understory | |
| 53 | Common spruce | Picea abies | 32 to 42 | 3 to 6 | 18-20 | G | F | F | 10% | #WA | | 7 trees. Some broken | REMOVE FOR |
| | · | | | | | | | | | | | branches/maintenance to lower | DEVELOPMENT |
| 53B | Common spruce, White pine, Norway maple, Red oak | Picea abies, Pinus strobus, Acer platanoides, Quercus rubra | 15 to 35 | 4 to 8 | 10 to 18 | F | F-P | F-P | 20% | #N/A | | Thick understory of Rhamnus/naturally regenerating species. 23+ trees in group. Snags | REMOVE FOR DEVELOPMENT |
| 53C | Cedar,White pine | Cedrus, Pinus strobus | 12 to 42 | 4 to 8 | 8 to 17 | F | F | F | 10% | #N/A | | Dense grouping of Cedar. Buckthorn. Shed adjacent. 25+ | REMOVE FOR DEVELOPMENT |
| 54 | White birch | Betula papyrifera | 36,35,33 | 13 | 18 | F | F-P | F | 20% | #N/A | | trees. Scarce interior canopies Spalding bark/Broken branches. 4 | REMOVE FOR |
| 54B | Cedar, White pine, White birch, Norway | Cedrus, Pinus strobus, Betula papyrifera, Acer | ,23 8 to 28 | 2 to 9 | 8 to 13 | F | F | F | 15% | #N/A | | leader Rhamnus. 50+ stems | DEVELOPMENT REMOVE FOR DEVELOPMENT |
| 54C | maple Poplar | platanoides Populus spp. | 57 | 11 | 20 | F | F | F | 10% | L | | Undergrowth of Cedar/Rhamnus | REMOVE FOR |
| 55 | Silver maple | Acer saccharinum | 86 | 13 | 19 | F | F | F-P | 25% | M | | Spalding bark. Maintenance to | DEVELOPMENT RETAIN & PROTEC |
| 56 | Honey locust | Gleditsia triacanthos | 49 | 13 | 13 | F-P | F-P | F | 20% | M | | leader Leader broken. Broken branches | REMOVE FOR |
| 57 | - | Acer platanoides 'Crimson | . 10-10-1 | 7 | 9 | F-P | G | G | 5% | #N/A | | Suckering at base. Peeling bark | DEVELOPMENT REMOVE FOR |
| | maple | King' | , | | | | | | | | | | DEVELOPMENT |
| 58 | Birch | Betula | 20, 29, | 6 | 11 | F | F | F | 5% | #N/A | | Multileader | REMOVE FOR |
| 59 | Common spruce | Picea abies | 20, 24 | 5 | 10 | G | F | F | 5% | #N/A | | | DEVELOPMENT REMOVE FOR |
| 39 | Common spruce | Filed dules | 25 | | 10 | G | | | 370 | #IWA | | | DEVELOPMENT |
| 55B | Col.Blue spruce | Picea pungens | 30 | 5 | 9 | G | G | G | 5% | #N/A | | | REMOVE FOR |
| | | 1 2 3 1 1 2 | | | | | | | | | | | DEVELOPMENT |

LOCATION MAP

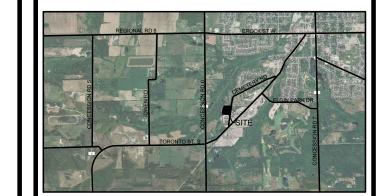


GENERAL NOTES

THE LOCATION OF PROPERTY LINES, ELEVATIONS AND FACILITIES ON THIS PLAN WERE DRAWN ON THE BASIS OF A DIGITAL SITE PLAN OR SURVEY DATA PROVIDED BY OTHER CONSULTANTS.

IT IS THE RESPONSIBILITY OF THE CLIENT AND HIS CONTRACTORS TO CONFIRM THE ACCURACY OF THE SETBACKS, LOCATIONS AND GRADES ETC. ANY VARIATIONS BETWEEN EXISTING CONDITIONS AND THIS PLAN SHOULD BE ADJUSTED ON SITE AND REPORTED TO THE CONSULTING LANDSCAPE ARCHITECT TO DETERMINE THE IMPACT OF THE VARIATIONS ON THE SUITABILITY OF THE PROPOSED DEVELOPMENT.

CONSTRUCTION MUST CONFORM TO ALL CODES AND REQUIREMENTS OF AUTHORITIES HAVING JURISDICTION.

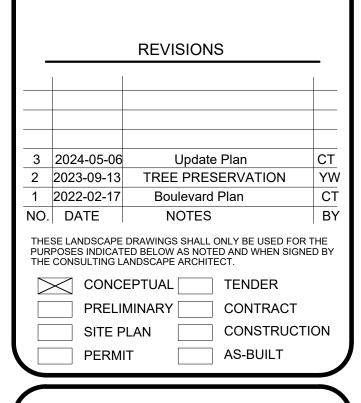



THESE DRAWINGS ARE INSTRUMENTS OF SERVICE AND THE LANDSCAPE ARCHITECT RETAINS OWNERSHIP OF THESE DRAWINGS. THEY ARE FOR SITE PLAN APPROVAL ONLY AND MAY REQUIRE FURTHER CONSTRUCTION DETAILING AND COORDINATION WITH OTHER ASSOCIATED PROFESSIONAL DESIGN SERVICES BEFORE ACTUAL TENDER AND CONSTRUCTION COMMENCES. DIMENSIONS ARE TO BE VERIFIED PRIOR TO CONSTRUCTION. DRAWINGS ARE NOT TO BE SCALED. IT IS ADVISED THAT CONTRACTORS CONTACT THE LANDSCAPE ARCHITECT PRIOR TO CONSTRUCTION TO ENSURE THE USE OF THE LATEST REVISED DRAWINGS. THE LANDSCAPE ARCHITECT IS NOT LIABLE FOR ERRORS OR OMISSIONS ARISING FROM UTILIZATION OF THESE PLANS BEFORE THE SAID DRAWINGS ARE SEALED, SIGNED AND DATED, AND THE LANDSCAPE ARCHITECT IS CONTRACTED TO PROVIDE CONSTRUCTION ADMINISTRATION AND CERTIFICATION SERVICES BY THE OWNER. ALL APPARENT DISCREPANCIES ARE TO BE REPORTED IN WRITING TO THE LANDSCAPE ARCHITECT BEFORE CONSTRUCTION COMMENCES.


| PROJECT: | |
|----------|----------------------------------|
| | 150 CEMETERY RD. UXBRIDGE, ON |
| DRAWING: | |
| | TREE PRESERVATION |


DRAWN BY:
KL
1:250


CHECKED BY:
HJK
2021-08-27


DRAWING
2 of 5


File #2021-082

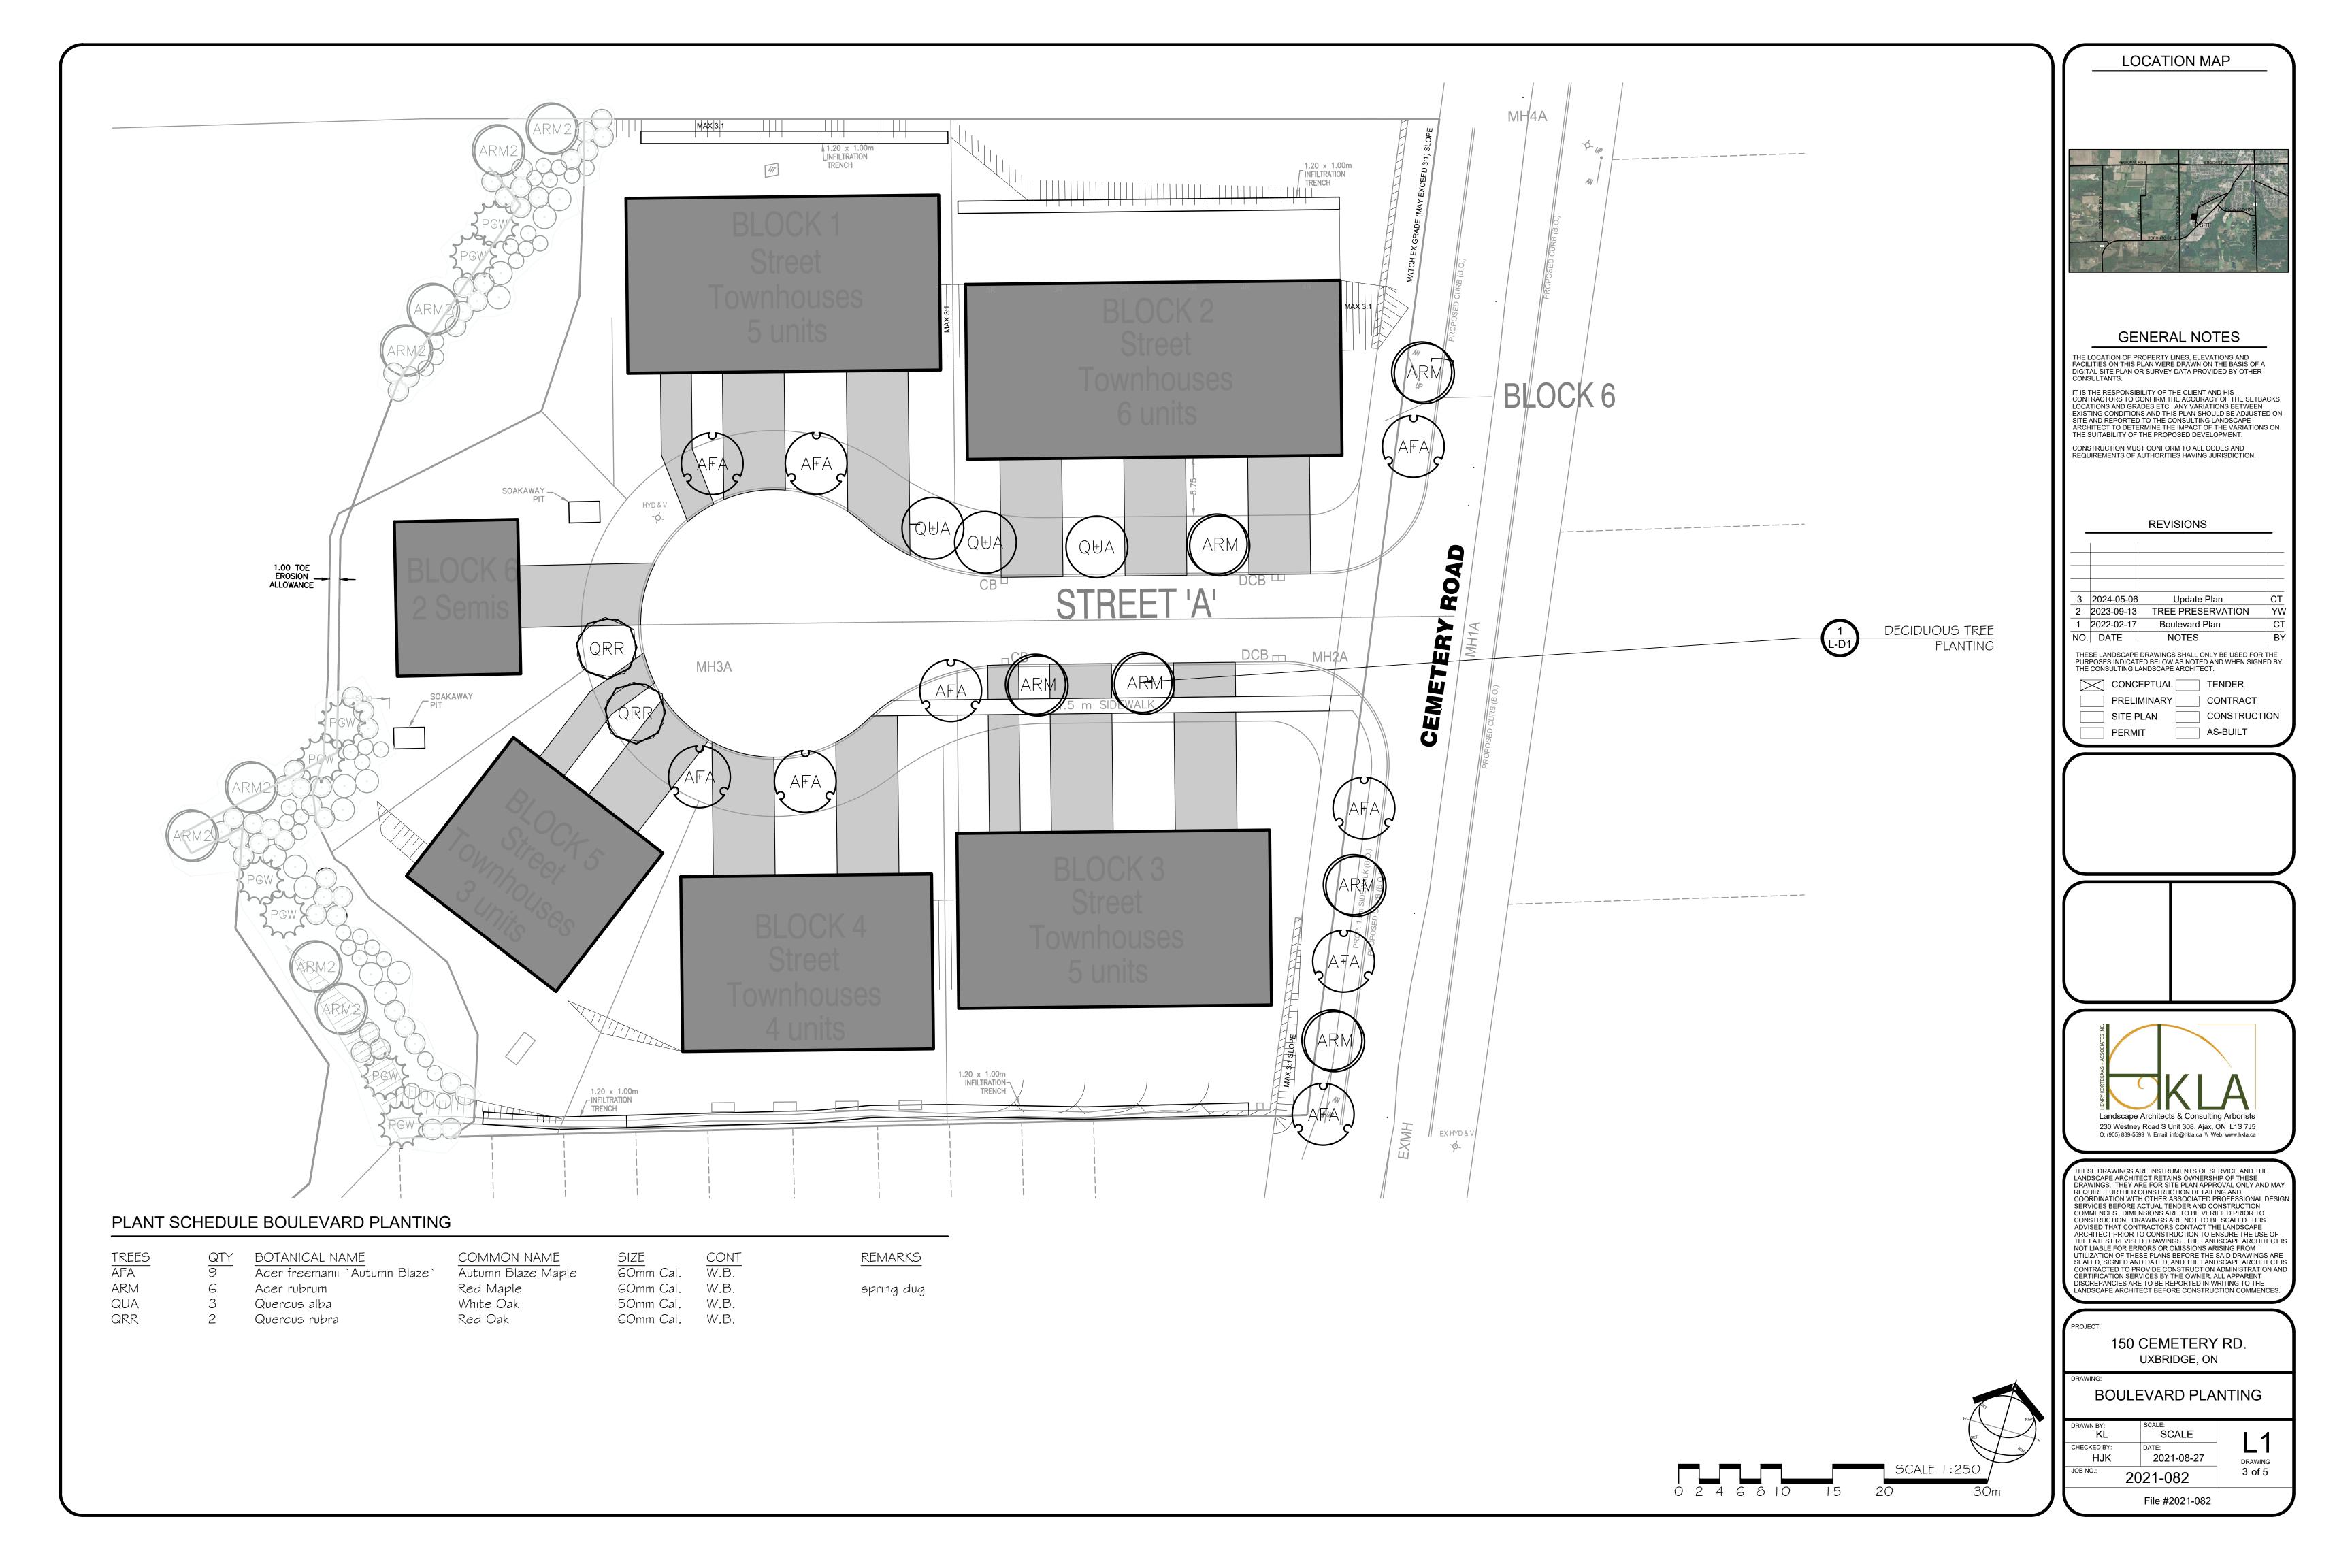

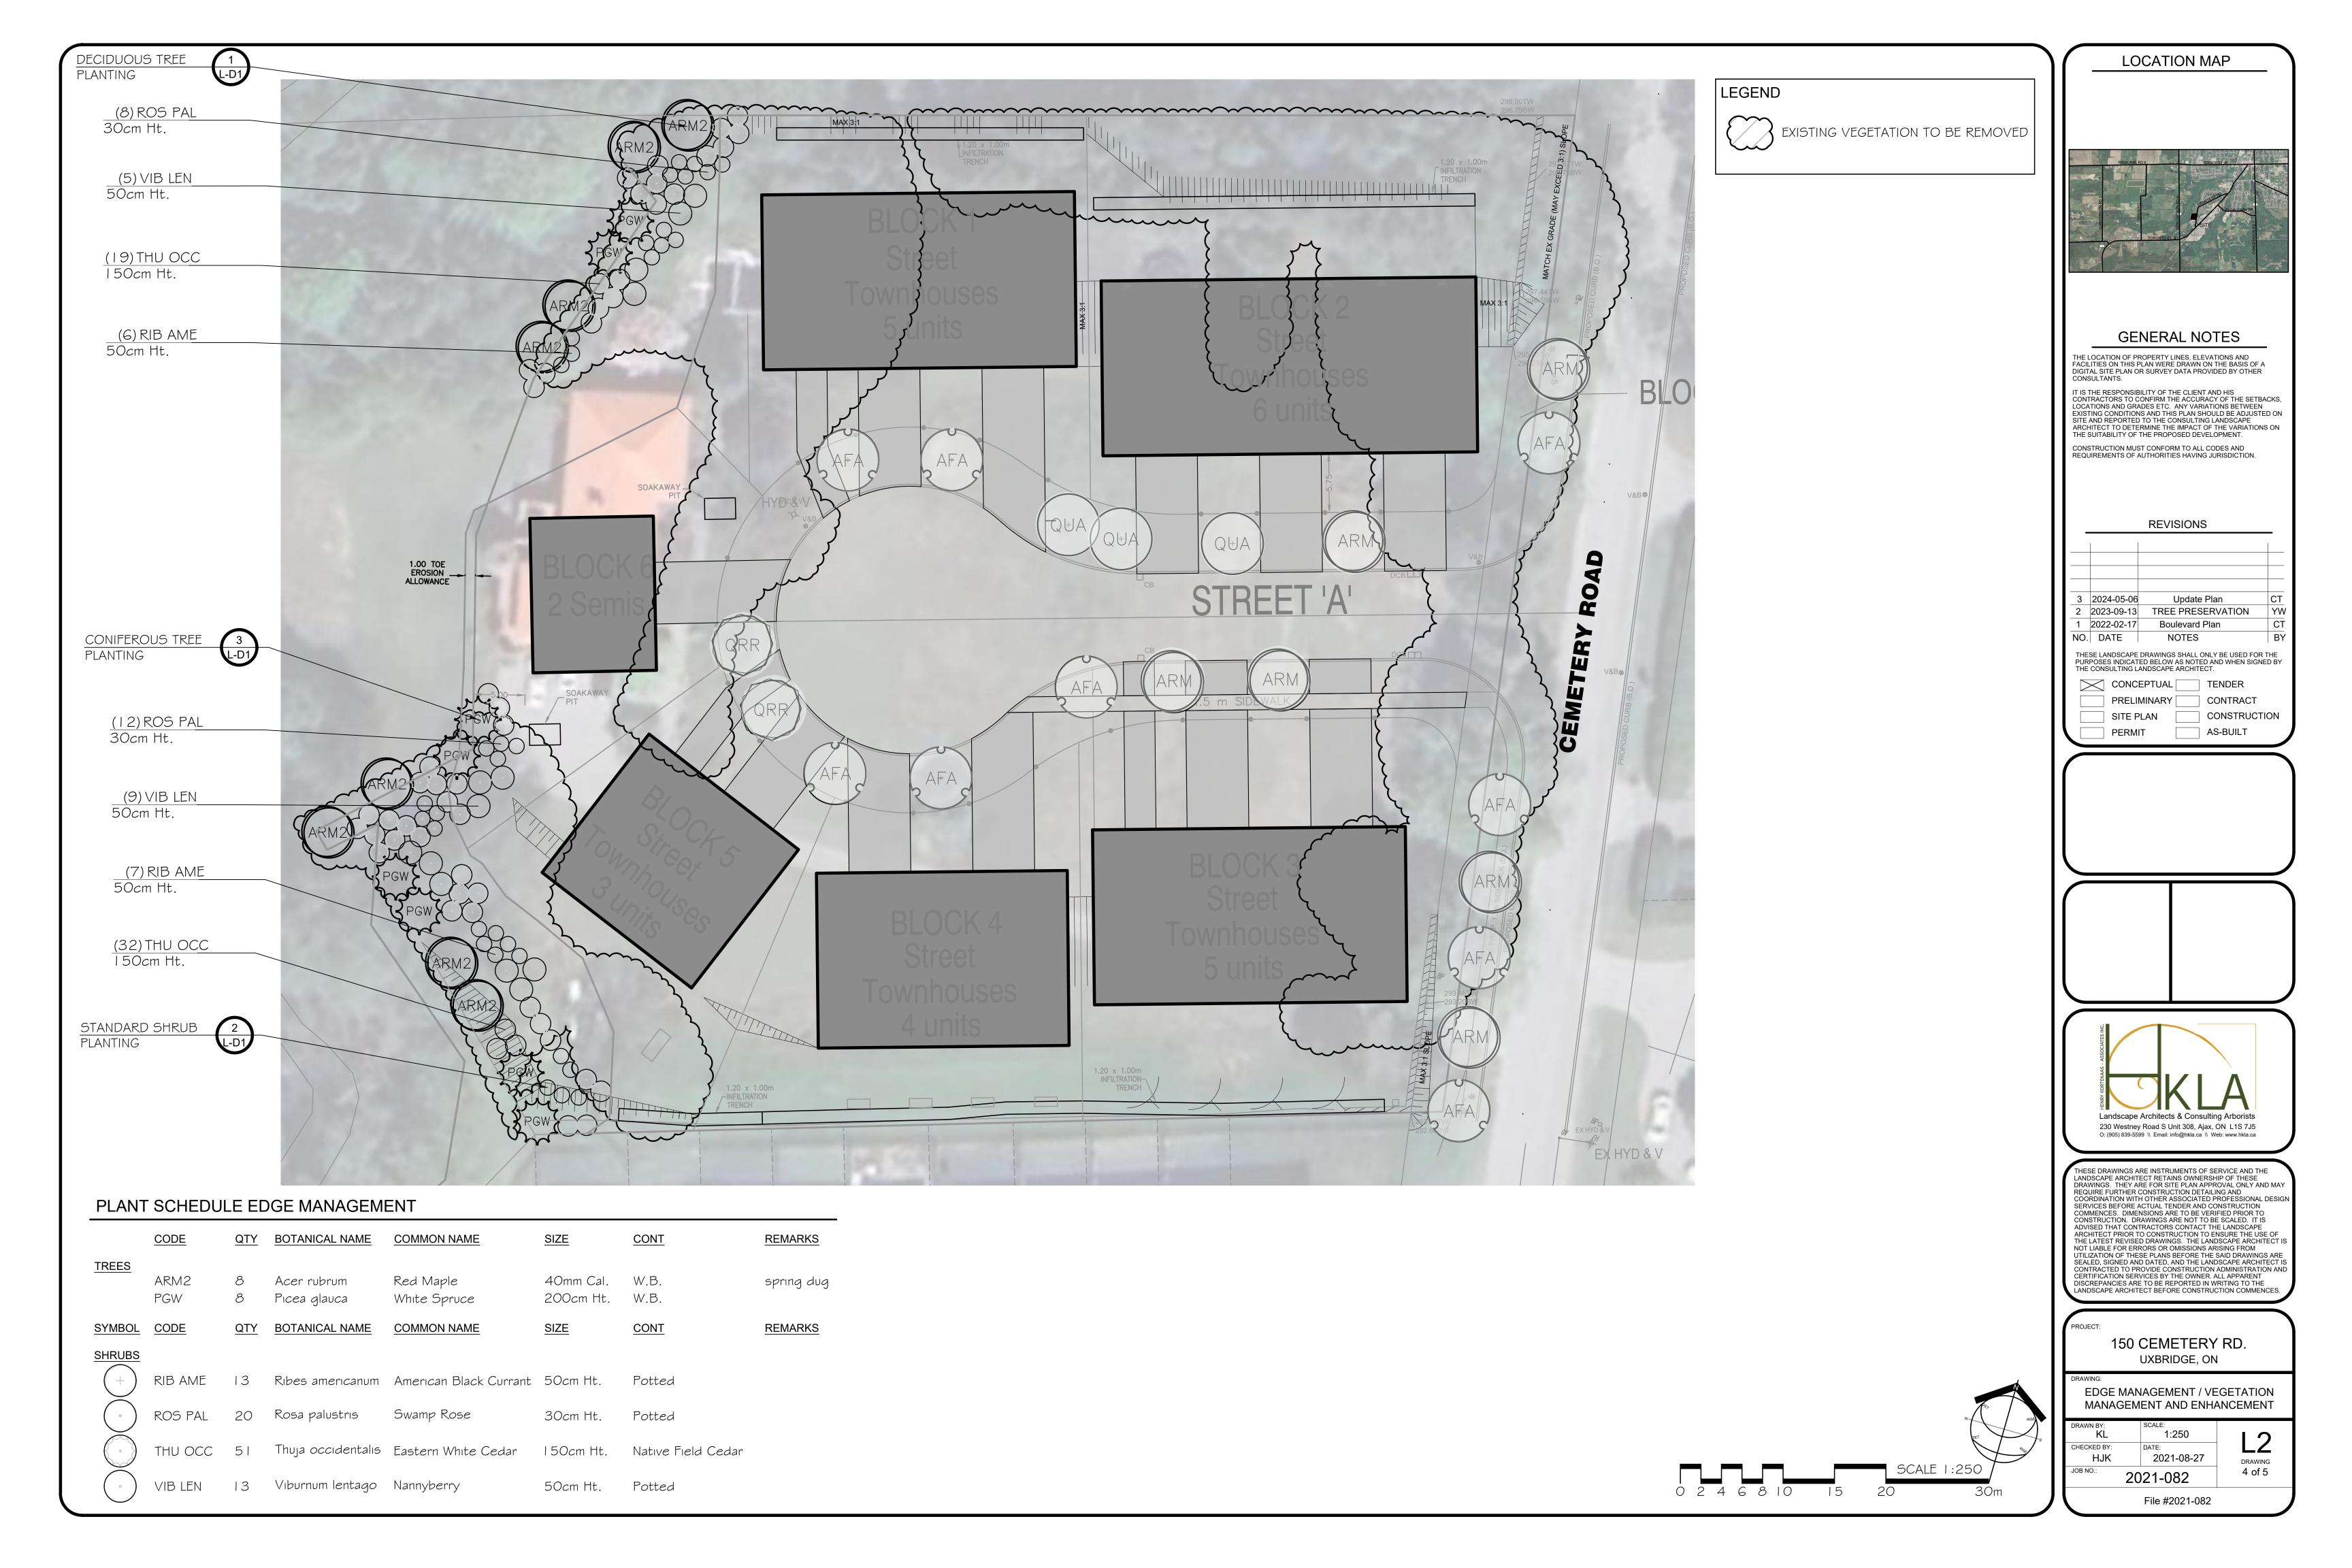

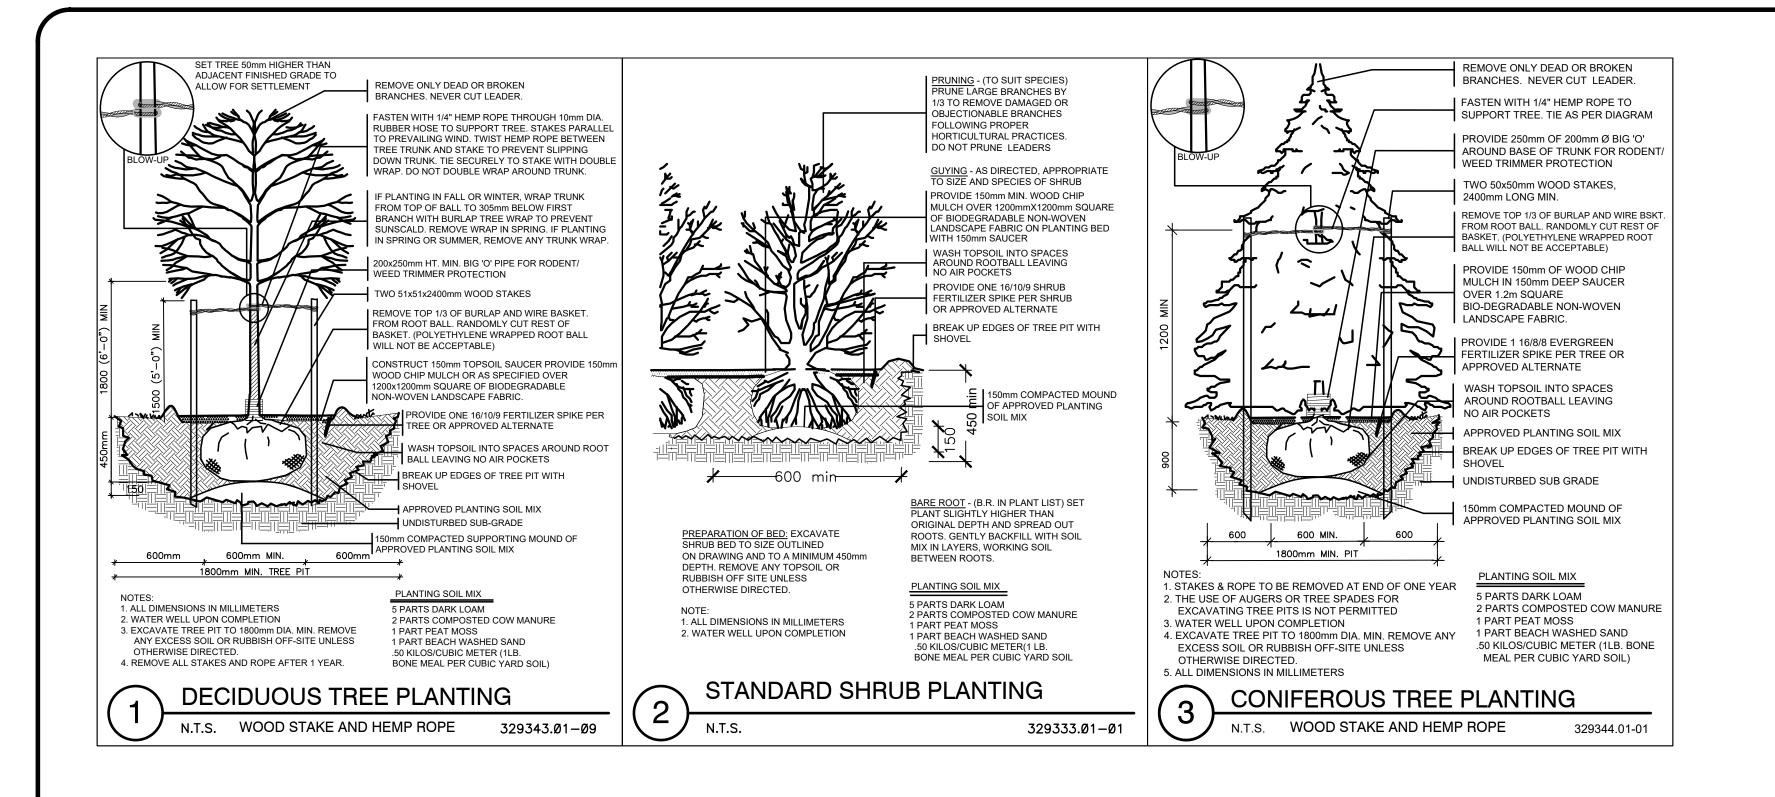

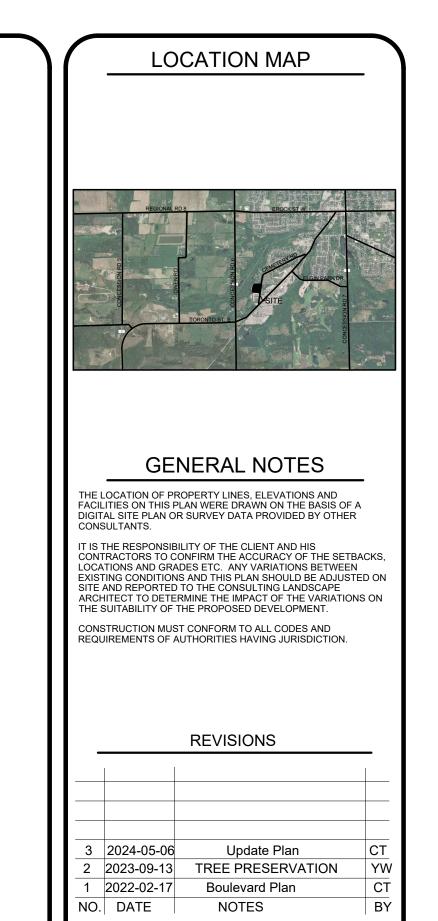

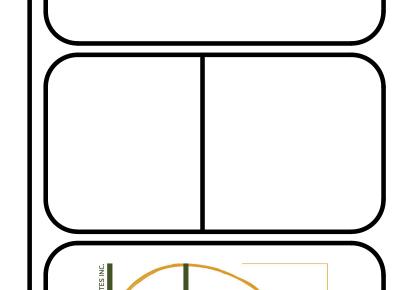

THESE LANDSCAPE DRAWINGS SHALL ONLY BE USED FOR THE PURPOSES INDICATED BELOW AS NOTED AND WHEN SIGNED BY

TENDER
CONTRACT

AS-BUILT

CONSTRUCTION

THE CONSULTING LANDSCAPE ARCHITECT.

PRELIMINARY

SITE PLAN

PERMIT

CONCEPTUAL

THESE DRAWINGS ARE INSTRUMENTS OF SERVICE AND THE LANDSCAPE ARCHITECT RETAINS OWNERSHIP OF THESE DRAWINGS. THEY ARE FOR SITE PLAN APPROVAL ONLY AND MAY REQUIRE FURTHER CONSTRUCTION DETAILING AND COORDINATION WITH OTHER ASSOCIATED PROFESSIONAL DESIGN SERVICES BEFORE ACTUAL TENDER AND CONSTRUCTION COMMENCES. DIMENSIONS ARE TO BE VERIFIED PRIOR TO CONSTRUCTION. DRAWINGS ARE NOT TO BE SCALED. IT IS ADVISED THAT CONTRACTORS CONTACT THE LANDSCAPE ARCHITECT PRIOR TO CONSTRUCTION TO ENSURE THE USE OF THE LATEST REVISED DRAWINGS. THE LANDSCAPE ARCHITECT IS NOT LIABLE FOR ERRORS OR OMISSIONS ARISING FROM UTILIZATION OF THESE PLANS BEFORE THE SAID DRAWINGS ARE SEALED, SIGNED AND DATED, AND THE LANDSCAPE ARCHITECT IS CONTRACTED TO PROVIDE CONSTRUCTION ADMINISTRATION AND CERTIFICATION SERVICES BY THE OWNER. ALL APPARENT DISCREPANCIES ARE TO BE REPORTED IN WRITING TO THE

LANDSCAPE ARCHITECT BEFORE CONSTRUCTION COMMENCES.

Landscape Architects & Consulting Arborists 230 Westney Road S Unit 308, Ajax, ON L1S 7J5 O: (905) 839-5599 \\ Email: info@hkla.ca \\ Web: www.hkla.ca

| PROJECT: | O CEMETERY UXBRIDGE, ON | | |
|--------------------|----------------------------|--------|--|
| DRAWING: | DETAILS | | |
| DRAWN BY: | SCALE: AS SHOWN | I D1 | |
| CHECKED BY: HJK | DATE: 2021-08-27 | L-D1 | |
| JOB NO.: | 2021-082 | 5 of 5 | |

File #2021-082